

PARTS & SERVICE NEWS

REF NO. AA00142

DATE July 10, 2000

(C)

Page 1 of 2

SUBJECT: CORRECTION OF FUSE BOXES IN OPERATORS CAB

PURPOSE: To instruct how to correct the fuse boxes

APPLICATION: HD325-6 Dump Trucks, S/N 5292
HD785-3 Dump Trucks, S/N 2269 thru 2276, 2278 thru 2283, 2290 and 2291
HD785-5 Dump Trucks, S/N A10228 and up
330M Dump Trucks, S/N Cf24120 and up

FAILURE CODE: 55005C

DESCRIPTION:

The fuses in the fuse box in the operator's cab may be installed different from those indicated on the nameplate. In this case, rectify them according to this **PARTS & SERVICE NEWS**.

2. Correction procedure

- (1) Open the rear cover in the operator's cab.
- (2) Remove the two mounting screws of fuse box A (BT3), and reinstall it inversely (Fig. 1 and Fig. 2).

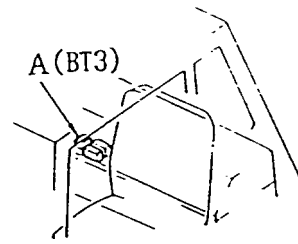


Fig. 1

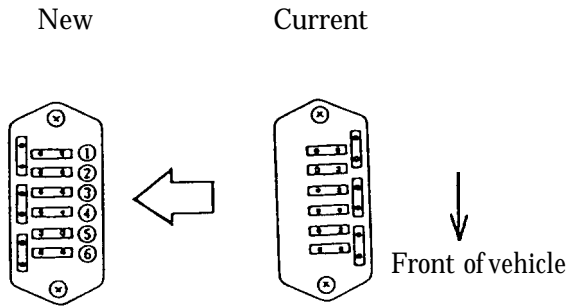


Fig. 2

- (3) After inverting fuse box A, exchange fuses ② and ⑤ with each other.

New	Current
② : 20A	10A
⑤ : 10A	20A

3. Check after correction

Confirm that the capacity of each fuse in fuse box A now conforms to that on the fuse nameplate (Fig. 3) stuck to the back of the rear cover.

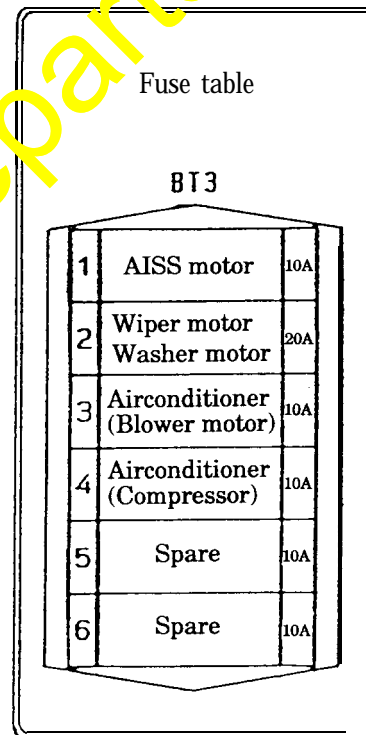


Fig. 3