PARTS & SERVICE NEWS

REF NO.	AA01081
DATE	May 7, 2001

Page 1 of 2

SUBJECT: NEW CYLINDER LINERS FOR NEW PRODUCTION 114 SERIES BLOCKS

PURPOSE: To introduce a production change in cylinder block machining.

APPLICATION: See Parts & Service News AA97079

FAILURE CODE: A220PA

DESCRIPTION:

This Parts & Service News introduces a new cylinder liner for 114 engine series with modified blocks that stop 3mm shorter than the old block (refer to Fig. 1 and 3).

The new cylinder liner part number 6742-01-5159 is 3mm shorter than the old, part number 6742-01-1500. The old liner in a new block will sit above the head deck by a cout 3mm, which is unacceptable (refer to Fig. 3). Therefore, when replacing 114 Series blocks, the liner must also be replaced. However, the old Part No. 6742-01-1500 will be retained as a service part for engines built prior to the engine serial numbers listed below.

Engine Serie Number First

<u>Date</u>

15636466

January 5, 1998

21301477

February 20, 1998

Old 114 Series Block

6742-01-1500

New 114 Series Block 6742-01-5159

WARNING! Replace a cyan ler liner only with an identical one. Only use the new cylinder liner on new 114

Series blocks.

The following has been superseded:

Old (Obsolete) 1294 789 H91

Cylinder Liner Service Part N

Style

New (Supersedes Old)

Repair Kit 6742-01-5481

When replacing liners within the old 114 Series block (**not replacing the block**), liner kit, Part No. 6742-01-1500, is still available with the old liner.

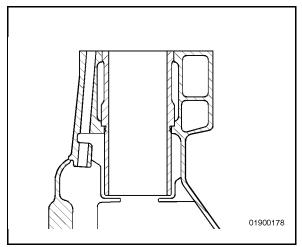


Fig. 1, Old Liner/Old Block

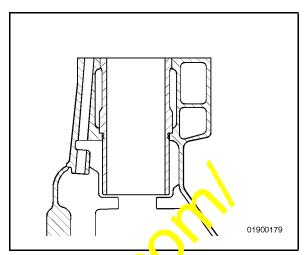


Fig. 2, Nev Line. New Block

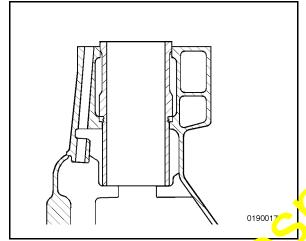


Fig. 3, Old Liner/New Block