COMPONENT CODE	03
----------------	----

# PARTS & SERVICE NEWS

**REF NO.** | AA01115

**DATE** June 29, 2001

Page 1 of 3

**SUBJECT:** FAN GUARD MOUNTING REWORK

**PURPOSE:** Introduce the procedure to modify the fan guard mounting

APPLICATION: WA800-2LWheel Loader Serial Number A20001 through A20024 WA800-2LC Wheel Loader Serial Number A20021 through A20028 WA900-1L Wheel Loader Serial Number A20001 through A20013 WA900-1LC Wheel Loader Serial Number A20010 through A20023

FAILURE CODE: 0341GJ

 
## **DESCRIPTION:**


### 1. Introduction

With the above wheel loaders, the top fan guard mounting plate might be broken by the vibration at high hours. In that case, replace mounting plate on radiator shroud to follow this service news.

## 2. List of parts

Part No.	Part Name	Purpose	Quantity	Remarks
01	Seat	Replacer ent	2	See Fig. 1




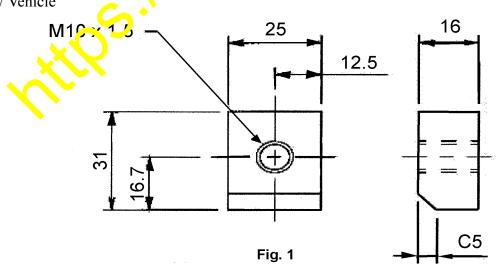



### **3. Modification procedures**


- 1. Uninstall fan guards from shroud.
- 2. Remove broken plates from radiator shroud (LH and RH, 2 places)

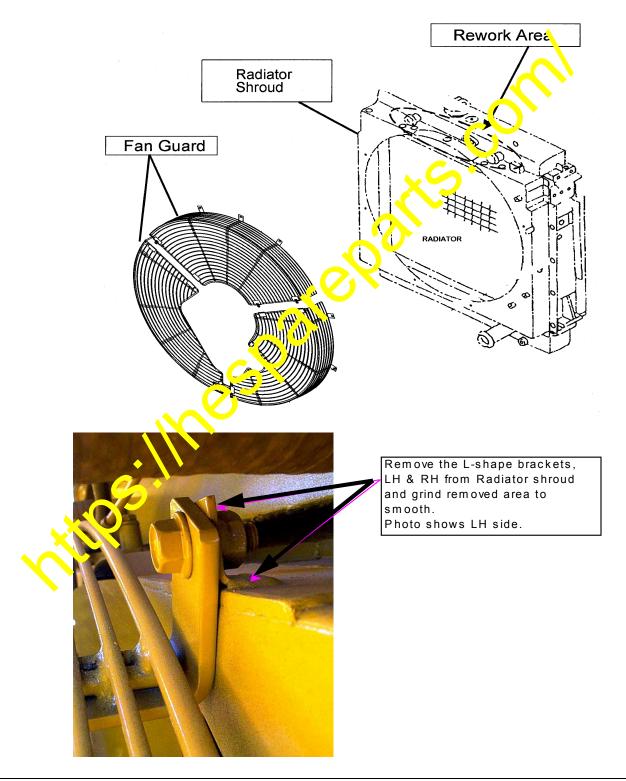

3. Weld new mounting block

Weld new seats as shown below.

Fan guards may be used for seat positioning.

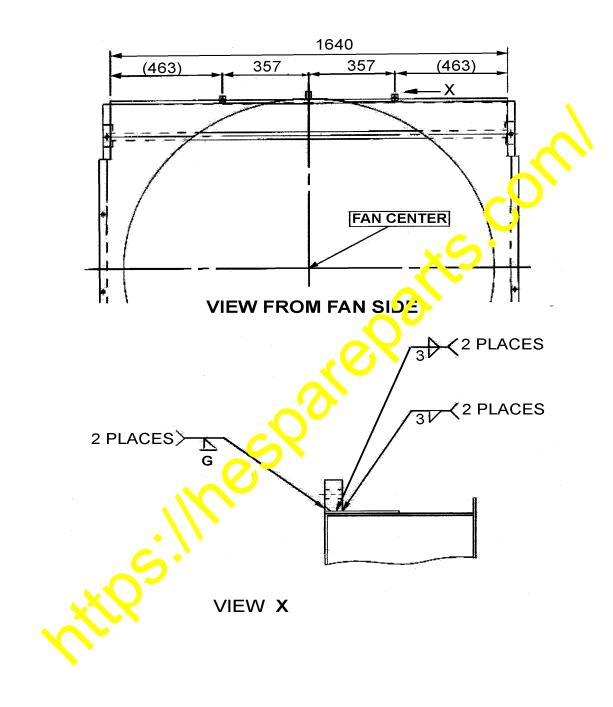

- 4. Paint reworked area on block
- 5. Install fan guards