PARTS & SERVICE NEWS

| REF NO. | - AA02102 | |
|---------|----------------|--|
| DATE | April 12, 2002 | |

Page 1 of 2

SUBJECT: ENGINE FAN GUARD REPLACEMENT

PURPOSE: Replacement of fan guard to prevent failure

APPLICATION: WA600-3L Wheel Loader Serial Number A52001 thru A52224

FAILURE CODE: 0341ZC

DESCRIPTION:



WARNING! Refer to the Operation and Maintenance Manual for applicable afet precautions.

To improve the durability of the fan guard, the 4 mm diameter wire he been changed to 6 mm.

Refer to the Illustration and new Parts List on page 2.


Removal

- 1. Remove the six bolts from the left and right side engine covers and remove the covers.
- 2. Remove the two (2) hose clip bolts which secure the aeration hose and makeup hose to the top guard.
- 3. Remove the twelve (12) bolts which secure the guard to the fan shroud and remove the guard.

Installation

- ★ Follow this tightening procedure to beep stress on the guard to a minimum.
 - 1. Loosely install all eight (8) attacking bolts that secure the guard to the fan shroud.
 - 2. Loosely install the five 5, bolts that connect the guard sections together.
 - 3. Tighten the bolts in the following manner.
 - a. Tighten the five (5) bolts that join the guard sections together.
 - b. Tighten one (1) boit near the top center of the guard.
 - c. Then tighted buts on either side of the first bolt and work down alternating from side to side until all the bolts are secure.
 - 4. Replace the two (2) hose clip bolts to secure the aeration hose and makeup hose to the top guard.
 - 5. Replace the left and right side engine covers and secure them with the bolts removed earlier.



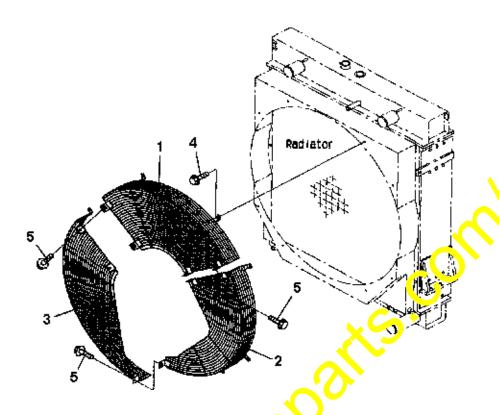

Parts List

| ITEM NO. | PART NO. | DESCRIPTION | QTY |
|----------|-----------------------------|------------------|-----|
| 1 | 426-03-232/3 | GUARD, FAN, TOP | 1 |
| 2 | 426-03 23223 | GUARD, FAN, L.H. | 1 |
| 3 | 42 <mark>5-07-252</mark> 33 | GUARD, FAN, R.H. | 1 |
| 4 | บ ¹ 455-01020 | BOLT | 8 |
| 5 |)1435-01025 | BOLT | 5 |