## PARTS & SERVICE NEWS

REF NO.	AA03007
DATE	December 16, 2002

Page 1 of 3

**SUBJECT:** CRACKING IN STEERING ACCUMULATOR TO BLEEDDOWN

MANIFOLD TUBING

**PURPOSE:** To inform the field of a kit for replacing accumulator to bleeddown manifold

tubing with flexible hoses.

**APPLICATION:** Komatsu Mechanical Drive Dump Trucks:

530M: A30001 thru A30038, 32628;


HD1500-5: A30039 and Up

**FAILURE CODE:** 6A01HA

**DESCRIPTION:** Steering Accumulator Tube Replacement Kit (XKO183)

Some trucks in the field may experience cracking of tubes (1 & 4, Figure 1) that connect the steering accumulator to the bleeddown manifold. The short length of the tube, along with alignment difficulties can cause excessive stress on the tubes, resulting in tube cracks.

Steering Accumulator Tube Replacement Kit (XK0183) has been developed to replace the tubes with flexible hoses. The use of longer, flexible hoses requires some changes in hookup and porting on the bleeddown manifold. These changes, along with additional instructions, are outlined on the installation drawing (EK4826) included in the kit and shown of page 3 of this bulletin. Refer to Table 1 for a complete listing of kit contents.

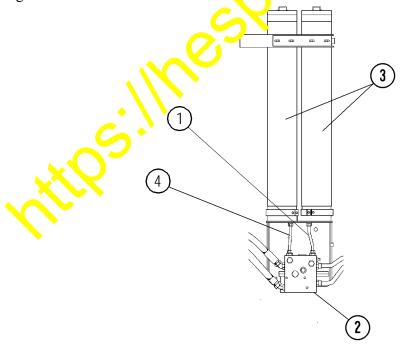

1. Tube (EK8286)


3. Accumulators

2. Bleeddown Manifold

4. Tube (EK8285)

FIGURE 1. STEERING ACCUMULATOR TO BLEEDDOWN MANIFOLD TUBES

TABLE 1. STEERING ACCUMULATOR TUBE REPLACEMENT KIT (XK0183)			
Item Number	Part Number	Description	Quantity
-	EK4826	Drawing, Steering Accumulator Tube	1
1	WB0542	Fitting, 45 Degree Elbow	1
2	HA7893	Hose	
3	WB0516	Fitting, 90 Degree Elbow	2
4	WB0377	Fitting, 90 Degree Elbow	2
5	HA4757	Hose	1
6	VZ1061	Adapter	1
7	VM0317	Plug	2
8	VM0319	Plug	2
9	VM0313	Plug	1
10	WB0574	Fitting	1
11	TF5194	C Ring	1
12	SV5630	Fring, Adapter	1
13	WB0593	Fitting	1

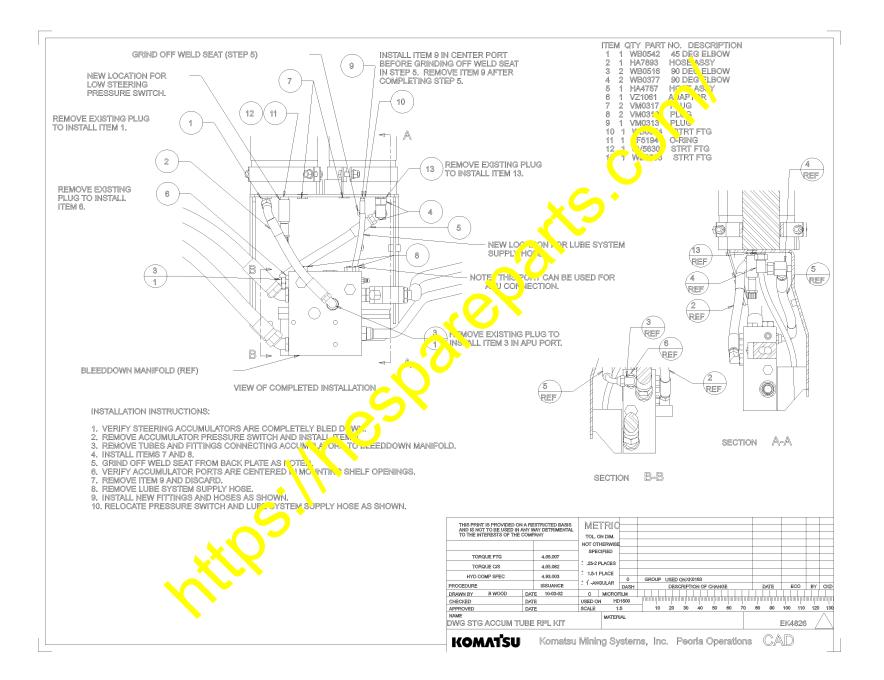

Page

S