AA98040

AA98040

April 17, 1998

REF NO.

DATE

PARTS & SERVICE NEWS

Page 1 of 3

SUBJECT: CENTER DRIVE SHAFT

PURPOSE: To provide the proper parts list for the center drive shaft

APPLICATION: WA180-3 Wheel Loader S/N A80001 and up

FAILURE CODE: 200099

DESCRIPTION:

Introduction:

WA180-3 Wheel Loaders built from January through June 1997 had center drive shaft 417-20-A1110, which may interfere with the front transmission yoke when the machine is fully articulated.


WA180-3 Wheel Loaders built after June 1997 have center drive shaft 417-20-A1120, which eliminates this possible interference.


Field campaign A7031 was released to shange the center drive shaft of the earlier machines from 417-20-A1110 to 417-20-1120. There are no machines in the field with the displaced drive shaft.

The serviceable sub-components (spider assembly and bolts) are <u>not</u> interchangeable, and are used as follows:

 	PILER ASS'Y	BOLT
Front, Rear 🖕	417-20-A1030	25705R1
Center	417-20-A1130	25772R1





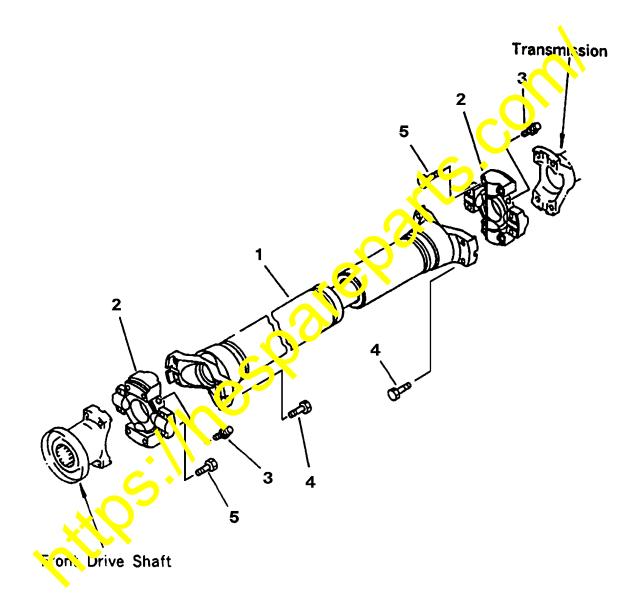

F4200W01.30P

Description **Item Part Number** Qty. Ref. 417-20-A1120 **DRIVE** SHAFT ASSEMBLY, CENTER 1 1 NSS . SHAFT ASSEMBLY 1 . . . 2 417-20-A1130 SPI DER ASSEMBLY . . . 3 417-20-A1020 . FITTING, GREASE 1 4 25 772 R1 . BOLT 8 8 5 01050-61045 BOLT . . QS. Mest

CENTER DRIVE SHAFT

https://hespareparts.com