

**PARTS & SERVICE
NEWS**

REF NO.	AA99004
DATE	Dec. 28, 1998

Page 1 of 4

SUBJECT: IMPROVEMENT TURBO INLET HOSE**PURPOSE:** To introduce modification procedures to prevent entry of dust into the turbo inlet hose**APPLICATION:** HD465-5 Dump Trucks, S/N 4221 thru 4559 (Engine No. 16493 thru 18354)
WA700-1 Wheel Loaders, S/N 10099 thru 10131 (Engine No. 16287 thru 18261)
WA700-1LC Wheel Loaders, S/N A20001 and up**FAILURE CODE:** A1M430**DESCRIPTION:**

1. Introduction

The turbo inlet hose on the HD465-5 dump trucks and WA700-1 wheel loaders may suck dust through its joint. Make the modification introduced in this Service News to eliminate the possible entry of dust into the hose.

2. List of parts

Part No.	Part Name	Purpose of part	Q'ty	Remarks
6151-12-4470 (6162-13-8360)	Hose (Hose)	} Replacement	2 (2)	Current structure with the WA700 requires 8 units.
6162-15-4860 (07289-00105)	Clamp (Clamp)		4 (4)	
6127-81-4823	Gasket		2	