

FAILURE CODE: 2600PB

## **DESCRIPTION:**

In order to avoid overheating the disks of the multi disk blake the oil level has to be lowered as follows:

- 1. Adjust the oil level precisely to the minimum mark at the dipstick (Refer to Maintenance Manual; section "After 50 working hours").
- 2. Drain off 10 liters oil from the swing gea (Content old: about 52 l; content new; about 42 l).
  - After the modification of the oil level the old oil level gauge is no longe, usable for controlling (too short).

• A new gear cover with new dipstick will be released soon.

