PARTS & SERVICE NEWS

Ref.no.	AH04013
Date.	12.10.2004

Page 1 of 1

Subject: Engine – muffler gasket

Purpose: To introduce the exchange of the gasket between exhaust manifold and muffler to

avoid leakage and loosening of the tightening screws.

Application: WA65-5: H20051 up to H20060; H20062 up to H20080

WA70-5: H20051 up to H20068; H20070 up to H20083; H20085 up to H20109;

H20111 up to H20114; H20116

Failure code: A1THFA

Description: On the above-mentioned Wheel Loaders it can happen, that the gasket between exhaust manifold and muffler yields and the tightening series at lease. Therefore the

exhaust manifold and muffler yields and the tightening screen got bose. Therefore the


muffler gasket has to be changed to a new, improved gask et.

The work has to be done immediately.

Change of the gasket:

- Open the engine hood and tip up the cab at described in the Operation Manual.

 NOTE: Before tipping up the driver's cab, the machine has to be positioned straight and the articulated steering has to be secured with the locking pin!
- Screw out the tightening screws of the nuriller and remove the muffler.
- Remove the current gasket (42T-0.2-21 A20).
- Clean the sealing area of the exhaust manifold and the muffler.
- Set the new gasket (6130-12-3585) on the exhaust manifold.
- Screw on the muffler and tighten it.
- + Tightening torque = 55/N 3.
- Tip down the cab as the control of the Operation Manual.
- Start the engine and check the muffler for tightness.

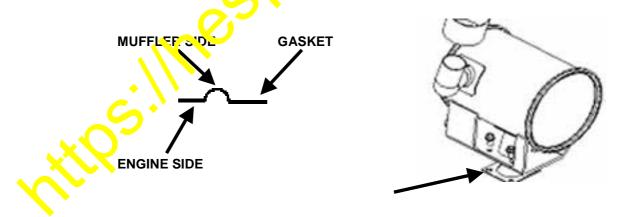

Spare Parts:

Name	P/N current	P/N new	Qty.
Gasket	42T-02-21A20	6130-12-5580	1

The necessary spare part will be sent to you from our B/U Service free of charge.