

COMPONENT CODE:

DT

REF NO.

AH04505 March 9, 2004

(C)

Page 1 of 1

SUBJECT: Chip indicator (contamination switch) at the main pumps

PN 906 281 40; 903 382 40 (ass'y.)

PURPOSE: Avoiding of malfunctions

PARTS & SERVICE NEWS

APPLICATION: PC4000 (SN 08151 – 08155); H 455S (15009):

PC5500 (15011 - 15019); PC8000 (12037 - \20\dagger)

FAILURE CODE: DT00MA


DESCRIPTION:

For simplification of the monitoring system and avoicance of error messages the chip

indicators are not more used in the hydraulic system.

1. Remove the cable of the chip indicators (a) and insulate it carefully (or remove it at the X2 board (b) - refer to the electric circuit diagram).

- 2. Replace the chip in licators with:
 - cover plug (7.1) 767 448 73) and
 - seal (2) 767 433 73).

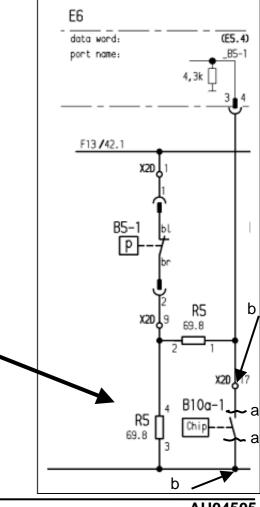

Example