

PARTS & SERVICE NEWS

REF NO.	AT01112
DATE	Jul. 23, 2001

Page 1 of 2

SUBJECT: IMPROVED ENGINE COMPRESSOR PIPING MOUNTING BRACKET ON HD785-3, 5/HD985-3, 5

PURPOSE: To introduce improved engine air compressor piping mounting bracket for use on HD785-3, HD785-5, HD985-3 and HD985-5 dump trucks

APPLICATION: HD785-3 Dump Trucks, Serial Nos. 2001 thru 2574
 HD785-5 Dump Trucks, Serial Nos. 4001 thru 4242
 HD985-3 Dump Trucks, Serial Nos. 1001 thru 1020
 HD985-5 Dump Trucks, Serial Nos. 1021 thru 1055

FAILURE CODE: 832JHA

DESCRIPTION:

1. Introduction

This Service News will introduce improved engine air compressor piping mounting bracket with increased durability for use on the HD785-3, HD785-5, HD985-3 and HD985-5 dump trucks.


2. List of parts

Part No.	Part Name	Q'ty	Remarks
561-35-62522 (561-35-62521)	Bracke (Bracke)	1 (1)	

3. Contents of the modification

Replace the current engine air compressor piping mounting bracket with the improved part.

(The items marked ☆ are the contents of the improvement.)

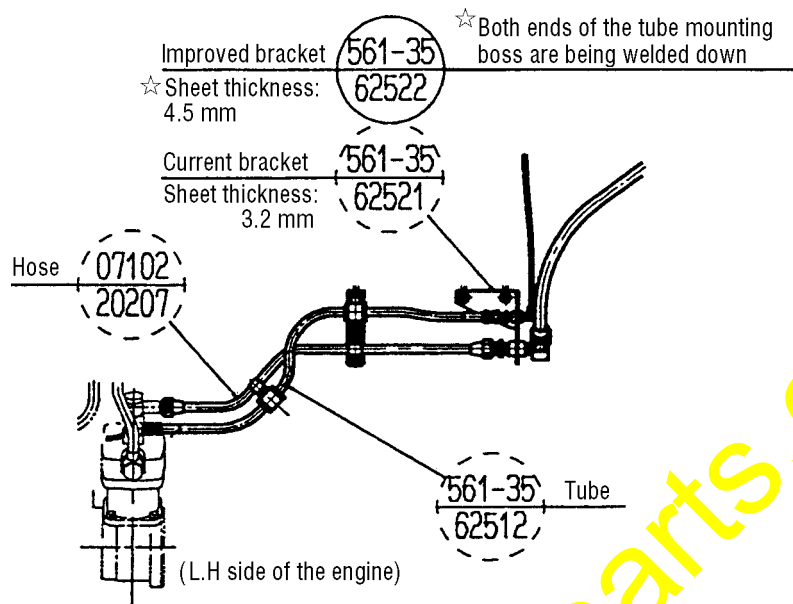

4. Modification procedures

4-1. Preparations

Park the vehicle on a level place, stop the engine, apply the parking brake and insert tire wedges underneath respective tires.

4-2. Draining the air from inside of the air reservoir tank

Before starting the bracket replacement work, drain the air from inside of the air reservoir tank.

4-3. Disconnecting the hose temporarily

Temporarily disconnect the hose (07102-20207) and the tube (561-35-62512) being connected to the bracket. (On the bracket side only)

4-4. Replacing the bracket

Replace the bracket with the improved part.

4-5. Reconnecting the hose

Reconnect the hose back to its original state.

5. Checking the vehicle

Start the engine and charge to fill the air into the air reservoir tank before checking if air leakage is not occurring while the air is being charged and when the air compressor is being unloaded.