

# PARTS & SERVICE

REF NO.	AT04027			
DATE	Mar. 4, 2004			
(C)	Page 1 of 5			

SUBJECT: REPAIR PROCEDURE FOR BROKEN AIR COMPRESSOR TUBE FOR

SA12V140 ENGINES

**PURPOSE:** To introduce modification procedure to repair broken air compressor tube

for the SA12V140 engines

**APPLICATION:** Refer to page 5

**FAILURE CODE:** AJ31FF

#### **DESCRIPTION:**

#### 1. Introduction

Since there is a possibility of occurrence of breakage failure with the air compressor tube for the SA12V140 engines by vibrations of the engine, make the modification to repair the broken tube following the modification procedure described anthis Service News.

Regarding the modification procedure for the rear side via compressor oil feeding tube, refer to the Service News No. AT02192.



### 2. List of parts


Part No.	Part Name	Purpose of part	Q'ty	Remarks
6215-81-5130 (6215-81-5221)	Tube (Tube)	Replacement	1 (1)	
6166-13-3440	Tube	Addition	1	
6215-81-5140	Joint	Addition	2	Front side oil feeding tube
6215-81-5460 (6150-51-9470)	Joint (Joint)	Replacement	1 (1)	
07005-01012	Gasket		7	Consumable part.
6215-81-5331 (6215-81-5330)	Tube (Tube)	Replacement	1 (1)	Tube
07005-01412	Gasket		4	Consumable parts

- Details of the modification
  Teflon flexible tube has been employed.
  The front side oil feeding tube has been divided to two.
- 4. Modification procedure Refer to the Shop Manual for the 12V140 Series engines.

Joint bolt tightening torque:

M10: 9.8 – 12.7 Nm (1.0 – 1.3 kgm) M14: 24.5 – 34.3 Nm (2.5 – 3.5 kgm)

ΓΙG. A7010-C7A1 AIR COMPRESSOR PIPING (2/2)(#11755-)

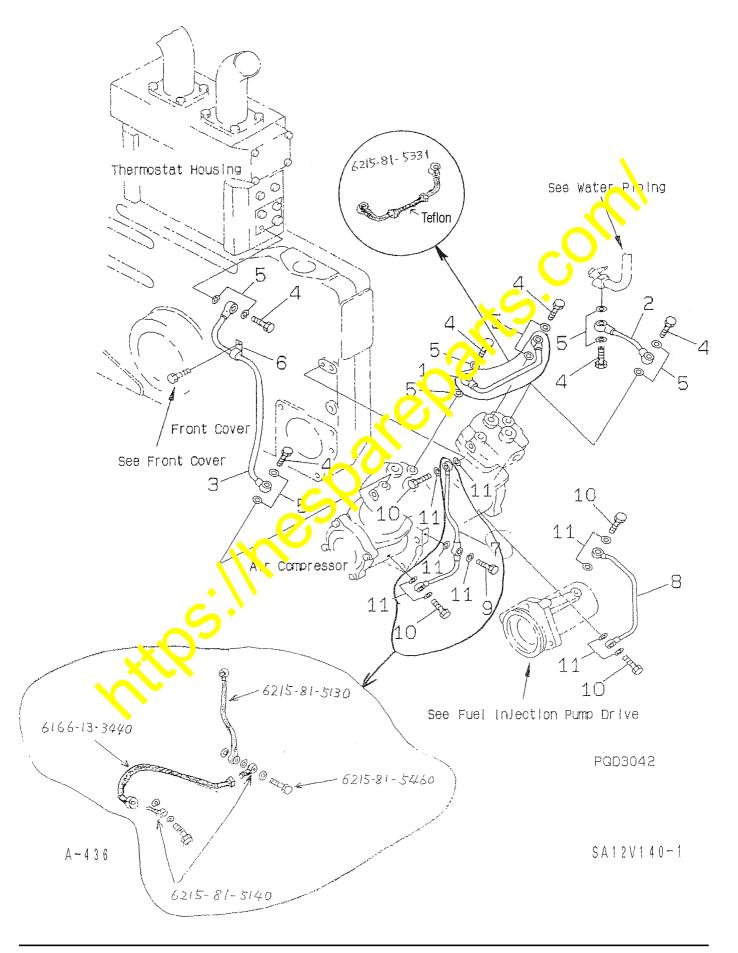

## Modification of the oil feeding tube for the air compressor

(Service News: Check table for the serial numbers of the machines with which immediate design change is applied)

No.	Applicable machine model	Engine Serial No. of the applicable machines		Modifi- cation	Machine Serial No. of the applicable machines	
		Machines in the field	Factory shipment of new machines with improved tubes	being made from	Machines in the field	Factory shipment of new machines with improved tubes
1	J12V140-WJK-1					•
2	J12V140-GCK-1					
3	SA12V140-W1-1					
4	HD785-2*					
5	HD785-3	Up to 13257			#2001 thru 2574	
6	HD785-5	Up to 13487	From the next shipment	<u> </u>	#4091 thru	
7	HD785-DZ-5			- <		
8	HD785-JK-5	Up to 13466			<u> </u>	
9	HV700-2				#1005 thru 1010	
10	HD985-3	Up to 13257			#1001 thru 1020	
11	HD985-5	Up to 13497	13498 and up	10/21	#1021 thru 1064, #1067	#1065 and up
12	WA800-1		16			
13	WA800-2	Up to 12732	From the next —		#10503 thru 10737	
14	WA800-3	Up to 13-192	shipment		#50001 thru 51002	
15	WA900-1	Up to \3310			#10001 thru 10009, 50001	
16	WA900-3	Up to 13496	13506 and up	10/23	#50002 thru 50035, 51001	