

PARTS & SERVICE NEWS

REF NO.	AA03027
DATE	February 3, 2003

SUBJECT: ENGINE FAN GUARD QUALITY.

PURPOSE: Replacement of the engine fan guards.


APPLICATION: WA600-3LK Wheel Loader Serial Number A53001 to A53018, A53020 to A53027

FAILURE CODE: 034190

DESCRIPTION: The original parts were not made to the required design. They may not have the appropriate welding at the wire to wire connection points. Resistance welding was used instead of the required fillet welds (2).

Affected Parts

Item	New Part	Description	Qty	Old Part
①	426-03-23114	GUARD, TOP FAN	1	---
②	426-03-23135	GUARD, RIGHT FAN	1	---
③	426-03-23141	GUARD, LEFT FAN	1	---

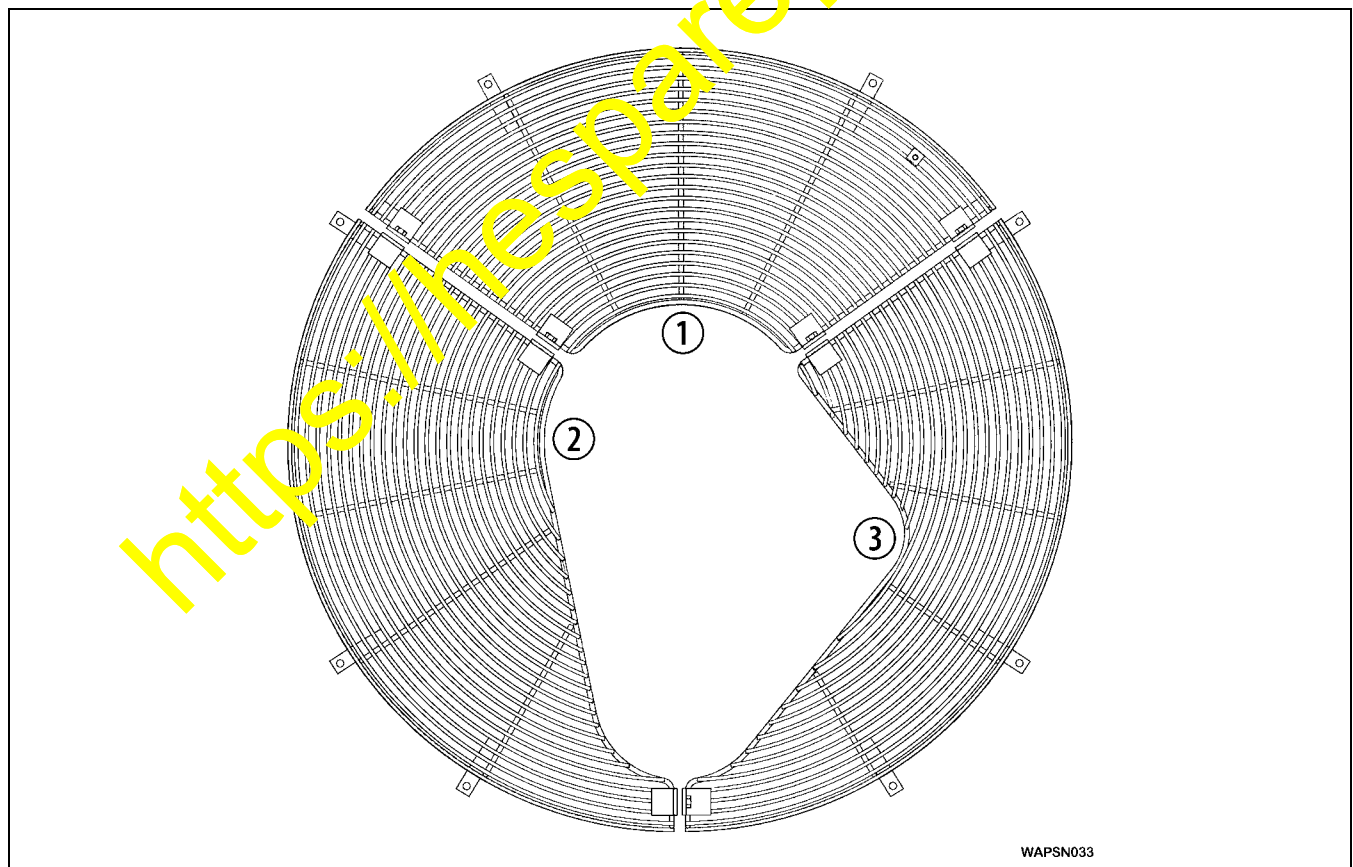

1. Replace the current engine fan guards with the updated guards. Follow the shop manual procedure.