

PARTS & SERVICE NEWS

REF NO.	AA98134
DATE	Sept. 14, 1998

Page 1 of 2

This **PARTS & SERVICES NEWS** supercedes AT98143 dated July 29, 1998 and should be discarded.

SUBJECT: NEW I/P SHAFT BEARING ON T/M

PURPOSE: To introduce a new input shaft bearing for the transmission of motor graders with improved durability

APPLICATION: GD825A-2 Motor Graders, S/N 10001 thru 12036


FAILURE CODE: 384138

DESCRIPTION:

Introduction:

1. This **PARTS & SERVICE NEWS** will introduce a new input shaft bearing for the transmission on the motor graders with improved durability
2. List of parts

3. Contents of the modification

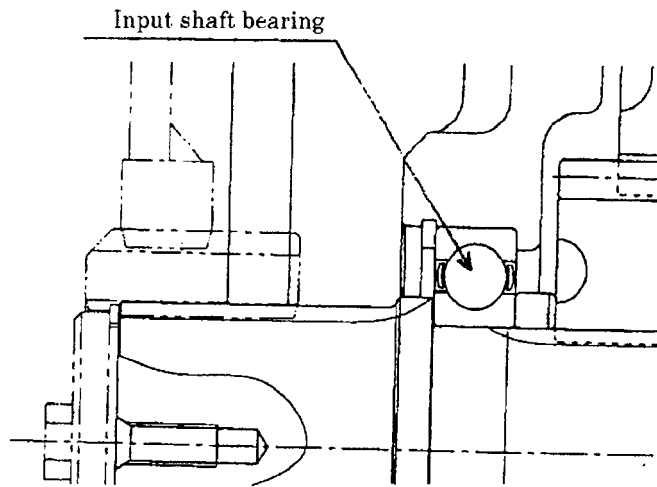

The input shaft bearing illustrated above have been improved.

Current Part
06040-06214



Improved Part
235-15-23310

Identification marking

Manufactures	Identification marking
NSK	A stamping reading "UR" is made on the inner ring
NTN	A stamping reading "TMB214C4" is made on the side face.

(Although the improved part is of the same size as with the current input shaft bearing, we have improved its strength by changing the heat treatment method.