


PARTS & SERVICE NEWS

Ref. No.	AH00013
Date.	19.09.2000

Page 1 of 2

- Subject:** Engine – Air cleaner bracket and air cleaner cover.
- Purpose:** Modification at the air cleaner bracket and correct mounting of the air cleaner cover.
- Application:** WA65-3 through WA95-3 ALL SERIAL NUMBERS
- Failure code:** AA0A01
- Description:** On the above mentioned Wheel Loaders it can happen that the tightening screws of the air cleaner bracket get loose. The reason therefore are the long holes in the air cleaner bracket. If this failure happens the following described rework has to be done:
- Remove one tightening screw (A), of the air cleaner bracket.
 - Lift on the bracket (B) with the air cleaner housing (C).
 - Paste the rubber (Pos.1) onto the air cleaner housing.
 - Screw on the bracket (B), with the tightening screw (A) and tighten it.

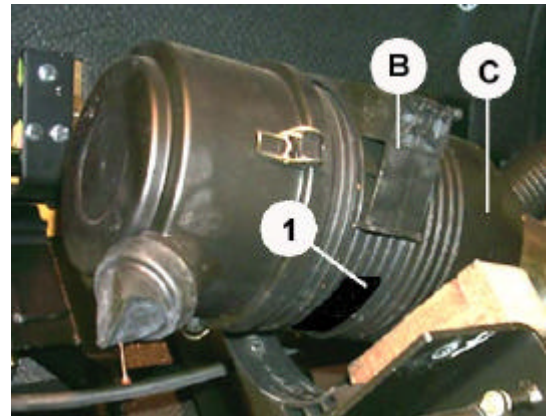


Spare parts:

Pos.	Name	P/N current	P/N new	Qty.
1	Rubber	-----	418-06-H4130	0.08 m

When replacing the air cleaner element, after cleaning or renewing, note that the element is setted in the middle of the housing.

The housing cover must be placed on carefully and the tightening clamps also must be closed easily.

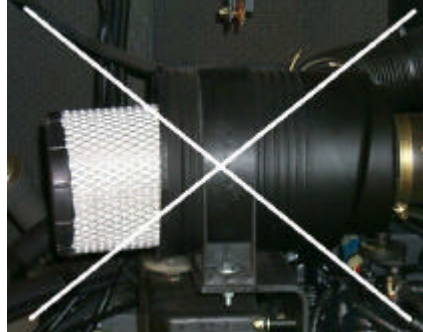

<https://hespareparts.com/>